

Instructions For Use

AFJ600-IFU

Rev. Date: April18, 2017

Revision: 3

Page 1 of 3

P.O. Box 3286 - Logan, Utah 84323, U.S.A. - Tel. (800) 729-8350 - Tel. (435) 755-9848 - Fax (435) 755-0015 - www.scytek.com

UltraTek HRP Anti-Mouse Staining System

Description: The UltraTek staining kit provides unmatched sensitivity with incubation times of 10 minutes each for the

Link Antibody and Enzyme Label.

Species of Origen:
Antigen Specificity:
Preabsorbed Against:
Enzyme Conjugate:
Chromogen Substrate:

Goat
Anti-Mouse
Human
Peroxidase
None provided

Max. Slides Stained: 500

Uses/Limitations: Not to be taken internally.

For In Vitro Diagnostic Use. Histological applications.

Do not use if reagents become cloudy. Do not use past expiration date. Use caution when handling reagents.


Non-Sterile.

Control Tissue: Any well-fixed tissue section.

Frozen tissue section.

Cell smear or cytocentrifuge procedure.

Ordering Information and Current Pricing at www.scytek.com

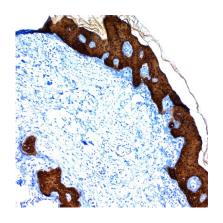

Availability:

Kit Contents	<u>Volume</u>	<u>Storage</u>
Super Block	15 ml x 4 vials	2-8°C
UltraTek Anti-Mouse	15 ml x 4 vials	2-8°C
UltraTek HRP	15 ml x 4 vials	2-8°C
	UltraTek Anti-Mouse	Super Block 15 ml x 4 vials UltraTek Anti-Mouse 15 ml x 4 vials

Precautions: Avoid contact with skin and eyes.

Harmful if swallowed.

Follow all Federal, State, and local regulations regarding disposal.

Storage: 2° C 8° C

ScyTek Laboratories, Inc. 205 South 600 West Logan, UT 84321 U.S.A.

 ϵ

IVD

Emergo Europe Prinsessegracht 20 2514 AP The Hague, The Netherlands



Instructions For Use

AFJ600-IFU

Rev. Date: April18, 2017

Revision: 3


Page 2 of 3

P.O. Box 3286 - Logan, Utah 84323, U.S.A. - Tel. (800) 729-8350 - Tel. (435) 755-9848 - Fax (435) 755-0015 - www.scytek.com

Procedure:

- 1. Deparaffinize and rehydrate tissue section.
- To reduce nonspecific background staining due to endogenous peroxidase, incubate slide in hydrogen peroxide for 10 minutes.
- 3. Wash 2 times in buffer.
- 4. If required, incubate tissue in digestive enzyme.
- 5. Wash 4 times in buffer.
- 6. Apply Super Block (blue cap), and incubate for 5-10 minutes at room temperature to block nonspecific background staining.

 Note: Do not exceed 10 minutes or there may be a reduction in desired stain.
- 7. Wash 1 time in buffer.
- 8. Apply primary antibody and incubate according to manufacturer's protocol.
- 9. Wash 4 times in buffer.
- 10. Apply UltraTek Anti-Mouse (yellow cap), and incubate for 10 minutes at room temperature.
- 11. Wash 4 times in buffer.
- 12. Apply UltraTek HRP (red cap), and incubate for 10 minutes at room temperature.
- 13. Rinse 4 times in buffer.
- 14. Apply chromogen intended for use with Peroxidase.
- 15. Counterstain and coverslip.











Instructions For Use

AFJ600-IFU

Rev. Date: April18, 2017

Revision: 3

Page 3 of 3

P.O. Box 3286 - Logan, Utah 84323, U.S.A. - Tel. (800) 729-8350 - Tel. (435) 755-9848 - Fax (435) 755-0015 - www.scytek.com

Troubleshooting Guide

Overstaining:

- Concentration of the primary antibody was too high or the incubation time was too long.
- 2. Temperature during incubation was too high.
- 3. Incubation time with link antibody or streptavidin/enzyme label was too long.

Nonspecific Background Staining:

- 1. Rinsing between steps was inadequate.
- 2. Tissue was allowed to dry with reagents on.
- 3. Folds in tissue trapped reagents.
- 4. Tissue contains endogenous peroxidase.
- 5. Tissue contains endogenous biotin.
- 6. Antigen migrated in tissue.
- 7. Excessive tissue adhesive on slides.
- 8. Inadequate blocking with protein block.

Weak Staining:

- 1. Primary antibody concentration was too low or incubation time was too short.
- 2. Reagents are past their expiration date.
- 3. Inadequate removal of wash water between steps, resulting in dilution of reagents.
- 4. Counterstain or mounting media were incompatible and dissolved the chromogen reaction product.
- 5. Room temperature was excessively cool.
- 6. The primary antibody does not recognize an antigen that survives fixation and embedding in high enough amounts.
- 7. Excessive incubation with protein block (Super Block or normal serum).

No Staining:

- 1. Steps were inadvertently left out.
- 2. There is no antigen in the tissue.
- 3. The primary antibody is not of mouse origin.
- 4. Chromogenic substrate has been replaced with another that is not intended for use with peroxidase.
- 5. One or more components of the kit have been inactivated.

